香港青年協會
the hongkong federation of youth groups

Phase III Redevelopment of The Hong Kong Federation of Youth Groups Jockey Club Sai Kung Outdoor Training Camp

Environmental Monitoring and Audit Report for February 2012







Ecosystems Limited
生態系統顧問有限公司
2/F, Kingsun Computer Building,
40 Shek Pai Wan Road,
Aberdeen, Hong Kong
香港香港仔石排灣道 40 號金山電腦大廈 2 樓
Tel. 電話: (852) 25530468
Fax 傳真: (852) 25529191
Email 電郵: ecosys@pacific.net.hk

	Name	Signature	Date
Prepared by	Mee-Ling Yau		6/3/2012
Checked by ET Leader	Vincent Lai		6/3/2012
Verified by IEC	Grace Kwok		9/3/2012

Issues and Revision Record

Issue	Date	Description
1	6 March 2012	Draft Issue
2	9 March 2012	Revised Issue

CONTENTS

Page

1. BASIC PROJECT INFORMATION 1
1.1 Project Background 1
1.2 Project Organisation and Management 1
1.3 Purpose of the Report 2
2. MONITORING AND AUDIT REQUIREMENT 2
2.1 Noise, Air and Water Quality 2
2.2 Landscape and Visual 2
2.3 Ecology 2
2.4 Waste Management 3
2.5 Site Inspections 3
3. SUMMARY OF WORK ACTIVITIES AND CONSTRUCTION STATUS 4
3.1 Works Undertaken during the Month 4
3.2 Construction Activities for the coming month 4
4. LANDSCAPE AND VISUAL 6
4.1 Tree Protection and Transplanting 6
5. ECOLOGY 7
5.1 Monitoring of Transplanted Incense Trees 7
5.2 Mangrove Monitoring 7
5.3 Off-Site Woodland Compensatory Planting 7
6. ENVIRONMENTAL AUDITING 9
6.1 Site Inspections 9
6.2 Non-Compliance Event 10
7. SUMMARY OF ENVIRONMENTAL PERMIT AND LICENSES 11
8. CUMULATIVE LOG OF COMPLAINTS AND REMEDIAL ACTION 11
9. CUMULATIVE LOG OF NOTIFICATION OF SUMMONS AND PROSECUTIONS 11
10. FUTURE KEY ISSUES 12
10.1 Key Issues for Coming Month 12
10.2 EM&A Schedule for the Coming Month 12
11. CONCLUSIONS AND RECOMMENDATIONS 12

LIST OF TABLES

Table 3.1 Works Activities in February 2012
Table 3.2 Anticipated Construction Programme in March 2012 and Potential Environmental Issues
Table 6.1 Summary of Waste Disposal in the Reporting Month
Table 7.1 Summary of Status of Environmental Permits/Licenses

LIST OF FIGURES

Figure 1.1 Site Location Plan
Figure 1.2 Master Layout Plan
Figure 4.1 Photo Records of Second Pruning for the Incense Trees to be Transplanted
Figure 5.1 Mangrove Compensatory Planting Site and Sampling Locations
Figure 5.2 Photo Records of Mangrove Seedlings
Figure 5.3 Tree Whip Planting Plan for Off-Site Woodland Compensatory Planting at Lui Ta Shek
Figure 5.4 Photo Records of Woodland Compensatory Planting at Lui Ta Shek

LIST OF APPENDICES

Appendix A Tentative Construction Programme
Appendix B The Key Contact Persons, Phone Numbers and Key Personnel
Appendix C Project Organisation
Appendix D Event and Action Plan for Landscape and Visual Impact - Construction Phase
Appendix E Event and Action Plan for Ecological Impact - Construction Phase
Appendix F Implementation Schedules for Mitigation Measures
Appendix G Monitoring Schedule for February 2012 and Weather Conditions during the Monitoring Period
Appendix H Average Height of Mangrove Seedlings
Appendix I Summary of Site Inspection, Outstanding Issues and Deficiencies
Appendix J Cumulative Log of Complaints and Summons/Prosecutions
Appendix K Tentative Monitoring Schedule for March 2012

Executive Summary

This is the eighth monthly Environmental and Audit (EM&A) Report for the project "Phase III Redevelopment of The Hong Kong Federation of Youth Groups Jockey Club Sai Kung Outdoor Training Camp" (Further Environmental Permit No. FEP-01/410/2010).

This report contains the results and findings of impact monitoring for the activities undertaken during the period of 1 February to 29 February 2012.

The site activities in the reporting period mainly consisted of hoarding, construction of temporary access road and minipiles at dormitory section. Weekly site inspections and landscape and visual monitoring were performed.

Implementation status of environmental mitigation measures, event/action plan and environmental complaint handling procedures were inspected during weekly site environmental audit. The Contractor has started to establish the waste management plans to handle solid and chemical wastes produced on site. In general, waste management was satisfactory during the reporting month. One non-compliance event on water quality was recorded but was rectified. There was no other complaint, notification of any summons and successful prosecutions against the project received during the reporting period.

The planned activities for March 2012 with regarding to construction consist of:

- Installation of Channel Planking
- Open Excavation
- Installation of Minipile

The anticipated environmental issues associated with construction will include generation of C&D material, mosquito control measures, and wastewater from drilling.

1. BASIC PROJECT INFORMATION

1.1 Project Background

1.1.1 The project "Phase III Redevelopment of The Hong Kong Federation of Youth Groups Jockey Club Sai Kung Outdoor Training Camp (hereinafter referred to as the "Project") is to redevelop the existing Jockey Club Sai Kung Outdoor Training Camp and increase the number of dormitories and canteen capacity in order to meet the increasing public demand. The Project Site is located at the southern extremity of Tai Mong Tsai, at the foothill of Cheung Shan and is accessed via Tai Mong Tsai Road. The Site Location Plan is shown in **Figure 1.1.**

1.1.2 The Project includes four major components: construct seven dormitory buildings comprising a total of 19 units on the lower portion of the slope southeast of the existing buildings; construct a new canteen block at the centre of the camp comprising a dining hall, a cafeteria, activity rooms and a drop off point for arrival of visitors; construct of two platform decks for outdoor activities; and construct a new wastewater treatment and reuse system. During the detailed design stage, the footprint of the new canteen block is slightly reduced, the total number of dormitory buildings is cut down to six, while only one platform deck (Deck A) will be constructed due to budgetary concerns. The Master Layout Plan is shown in **Figure 1.2**.

1.1.3 An Environmental Impact Assessment (EIA) study has been undertaken under the EIA Ordinance (Cap. 499) to provide information on the nature and extent of environmental impacts arising from the construction of the Project and was approved without conditions (AEIAR-157/2010) on 17 December 2010. An Environmental Permit (EP-410/2010) (EP) for the Project was granted to the Project Proponent, The Hong Kong Federations of Youth Groups on 10 January 2011. Under the requirements of Condition 4 of the EP, an Environmental Monitoring and Audit (EM&A) programme as set out in the EM&A Manual is required to be implemented. A Further Environmental Permit (FEP-01/410/2010) (FEP) for the Project was granted on 5 January 2012 to the foundation contractor, Konwall Construction & Engineering Co., Ltd., who would take up the responsibility of the foundation and site formation works of the Project.

1.2 Project Organisation and Management

1.2.1 The foundation contract for the Project was awarded to Konwall Construction and Engineering Co. Ltd. (Contractor) in June 2011 by the Project Proponent, The Hong Kong Federations of Youth Groups. The foundation works was anticipated to complete in 8 months followed by superstructure works under a separate contract. Due to technical issues, the foundation work will be extended for about two more months. The revised tentative Construction Programme is shown in **Appendix A**.

1.2.2 The Project Proponent has commissioned Ecosystems Ltd. as the Environmental Team (ET), which comprises the environmental team leader and the environmental technicians to undertake the environmental monitoring and audit work for this Project.

1.2.3 The Project Proponent has also commissioned Allied Environmental Consultants Ltd. as the Independent Environmental Checker (IEC) for the

Project.

1.2.4 The contact person and telephone number of key personnel for the Project are shown in **Appendix B**.

1.2.5 The project organisation for environmental management is shown in **Appendix C**.

1.3 Purpose of the Report

1.3.1 This is the eighth monthly EM&A Report prepared for the Project, pursuant to Condition 4.4 of the EP and FEP and the EM&A Manual issued for the Project. The report presents a summary of the EM&A works and lists of activities in February 2012 (from 1 February to 29 February 2012).

2. MONITORING AND AUDIT REQUIREMENT

2.1 Noise, Air and Water Quality

2.1.1 According to the EM&A Manual, no quantitative measurement of air, water or noise parameters are required. Upon commencement of construction, weekly site audits will be implemented to ensure that that appropriate environmental protection and pollution control mitigation measures are properly implemented (see Chapter 6 – Environmental Auditing).

2.2 Landscape and Visual

2.2.1 According to the EM&A Manual, monitoring and audit should be undertaken during the construction phase of the Project to ensure and check that the implementation and maintenance of landscape and visual mitigation measures are being properly carried out. Site inspections should be undertaken at least once every two weeks through the construction period to ensure the existing trees retained on-site are being well preserved, tree transplanting and felling operations are being undertaken in accordance with the requirements, procedures and specifications as stipulated in the contract and the approvals granted by concerned authorities, and all the newly planted vegetations are being maintained properly during the establishment period. In particular, the extent of the agreed works areas should be regularly checked during the construction phase. Any trespass by the Contractor outside the limit of the works, including any damage to existing trees, woodland and vegetation should be noted.

2.2.2 Contractor's submission and proposals on tree protection and transplanting should be reviewed, and the Contractor's landscape works should be monitored and audited.

2.2.3 Should non-compliance of the landscape and visual impacts occur, actions in accordance with the action plan stated in **Appendix D** should be carried out.

2.3 Ecology

2.3.1 According to the EM&A Manual, construction phase ecological monitoring includes the followings:

2.3.2 Inspect the transplanted individuals of *Aquilaria sinensis* the first three months after transplanting and quarterly thereafter for two years. Survival and growth should be observed and recorded with photo records.

2.3.3 Oversee the mangrove compensatory planting activities and monitor survival and growth of the mangroves quantitatively and monthly for the first three months and quarterly thereafter for one year. The mangrove seedlings planted at each stand will be sampled, and height and percentage survival measured.

2.3.4 Carry out site inspection for both on-site and off-site compensatory tree planting monthly for the first three month after planting and quarterly thereafter for two years. Survival and growth of representative species should be observed and recorded with photo records.

2.3.5 Weekly site inspections to ensure compliance of all construction activities with all appropriate environmental protection and pollution control measures which would in turn also safeguard the ecology of the Project Site.

2.3.6 Should non-compliance of the ecological impacts occur, actions in accordance with the action plan stated in **Appendix E** should be carried out.

2.4 Waste Management

2.4.1 According to the EM&A Manual, the weekly site inspections should include waste management issues to ensure compliance of all construction activities with all appropriate environmental protection and pollution control measures, including those set up in the Environmental Management Plan prepared by the main contractor. Waste management audit will also be carried out as part of the monthly audit by the IEC.

2.5 Site Inspections

2.5.1 According to the EM&A Manual, weekly site inspections should be conducted ensure that that appropriate environmental protection and pollution control mitigation measures are properly implemented. The Implementation Schedule of Mitigation Measures is attached in **Appendix F**.

2.5.2 The monitoring schedule for the reporting month and the weather conditions recorded during the monitoring period are shown in **Appendix G**.

3. SUMMARY OF WORK ACTIVITIES AND CONSTRUCTION STATUS

3.1 Works Undertaken during the Month

3.1.1 Works activities including hoarding, construction of temporary access road and minipiles at dormitory section have been commenced in the month of February 2012. A summary of works activities, locations, equipment/materials and dates of occurrence in February 2012 is provided by the Contractor, as shown in **Table 3.1**. Weekly site inspections were conducted on 7,14,21 and 28 February 2012.

Table 3.1 Works Activities in February 2012

Item	Work Activities & Location	Date of Occurrence
1	Hoarding – Dormitory	1 Feb – 8 Feb 2012
2	Temporary Access Road - Dormitory	1 Feb – 2 Feb 2012
3	Construction of Minipiles at Dormitory	9 Feb – 29 Feb 2012

Machineries		
	Equipment/Plant	Quantity
1	Excavator	3
2	Grab Lorry	0
3	Crane Lorry	1
4	Dump Truck	2
5	Generator	2
6	Welding Machine	4
7	Drilling Rig	2
8	Mobile Crane	2
9	Piling Rig	3
10	Air Compressor	3

3.2 Construction Activities for the coming month

3.2.1 The Contractor has provided an updated construction programme in **Table 3.2** to show the planned activities for the coming month. The anticipated environmental issues are summarised as follows:

Table 3.2 Anticipated Construction Programme in March 2012 and Potential Environmental Issues

Item	Works	Potential Environmental Issues
1	Installation of Channel Planking	- Generation of C&D material
2	Open Excavation	- Generation of C&D material
3	Installation of Minipile	- Wastewater from drilling - Mosquito mitigation measures should be implemented - Generation of C&D material

Machineries		
	Equipment/Plant	Quantity
1	Excavator	3
2	Grab Lorry	0
3	Crane Lorry	1
4	Dump Truck	1

Machineries		
	Equipment/Plant	Quantity
5	Generator	2
6	Welding Machine	4
7	Mobile Crane	1
8	Piling Rig	3
9	Air Compressor	3

4. LANDSCAPE AND VISUAL

4.1 Tree Protection and Transplanting

4.1.1 The Tree Protection and Transplantation Plan has been submitted to EPD on 14 March 2011, pursuant to Condition 3.3 of the EP and FEP.

4.1.2 All trees at the Dormitory and the Canteen Site were labelled according to the approved tree removal applications with blue (retained), red (fell) and yellow (transplanted) ribbons. These included the 3 nos. of Incense Trees to be retained and 5 nos. of Incense Tree to be transplanted[1]. Tree felling at Canteen Block area has been commenced.

4.1.3 Tree protection measures including construction of chain link fence at the Canteen Block area were completed in August 2011. Hoarding and tree protection work in the Dormitory area were about 95% completed. During site inspection, the contractor was also reminded of proper tree protection measures such as repairing damaged fences and carrying out remedial measures on retained trees with poor conditions. Inspection of the tree protection measures will continue.

4.1.4 Preparation works for tree transplantation have also been commenced accordingly. The second round of root pruning was carried out in 4 February 2012. Photo records were attached in **Figure 4.1**. As the location of the recipient site is finalised and ready, transplantation of the Incense Trees will be carried out on early March 2012.

4.1.5 No trespass by the Contractor outside the limit of the works, including any damage to existing trees, woodland and vegetation, was noted.

[1] The label of the Incense tree #776 reported dead during the baseline report was found to be swapped with another tree #775 nearby. The tree label was therefore rectified and total number of transplanted Incense Tree remained to be five (i.e. #775, #766, #643,#639 and #644).

5. ECOLOGY

5.1 Monitoring of Transplanted Incense Trees

5.1.1 Since preparation works for tree transplantation are still underway (see 4.1.4), no monitoring is conducted during the current session.

5.2 Mangrove Monitoring

5.2.1 The Mangrove Planting Plan was submitted to EPD in 11 March 2011, pursuant to Condition 3.3 of the EP and FEP. The Planting Plan was approved on 23 March 2011.

5.2.2 Planting was commenced and completed on 29 April 2011. About 1243 droppers of *Kandelia obovata* were planted on about 0.01 ha of sandflat following the protocol in the mangrove planting plan under the supervision of the ET. The planting area was further fine-tuned to avoid rocky/shallow substrate to enhance the survival (**Figure 5.1)**.

5.2.3 Mangrove monitoring was conducted quarterly in 14 February 2012 during the current monitoring session. As recommended during the last monitoring session in November 2011, some of the 10 1m x 1m quadrats were relocated to measure survived seedlings (**Figure 5.1)**. Number of mangrove seedlings was counted, and height measured from ground level (including length of the exposed dropper) to the top of the seedling to the nearest cm. The health condition of the planted seedlings was also noted. Photo records of the mangrove plantings were taken (**Figure 5.2**).

5.2.4 A total of 16 seedlings with an average height of 15.3 cm was found survived within the 10 quadrats (**Appendix H**). New leaves were observed resprouted from the grazed seedlings, although the health conditions were fair to poor. Some seedlings were also covered by algae, which always occur in early spring season. Head count of survived seedlings was conducted, and a total of about 120 seedlings remained.

5.2.5 Although the average height was reduced and percentage survival was low, regeneration of new leaves observed indicated that there may be more seedlings considered “dead” resprouting in the coming growing season. Mangrove planting however will be carried out as part of the nature conservation education programme as before. Monitoring will continue in May 2012.

5.3 Off-Site Woodland Compensatory Planting

5.3.1 The Tree Whip Planting Plan for Off-Site Woodland Compensatory Planting at Lui Ta Shek was submitted to EPD on 14 March and 27 April 2011, pursuant to Condition 3.3 of the EP and FEP. **Figure 5.3** shows the approved plan and planting specification.

5.3.2 Planting was commenced and was reported to be completed by the landscape contractor on 13 June 2011. Monitoring was conducted on monthly from July to September 2011. Due to poor condition of the plantings, and according to the Event and Action Plan for Ecological Impact (**Appendix E**), actions due to non-compliance were taken in accordance with the action plan. Monitoring was increased to monthly in October and November 2011. IEC was informed.

The landscape contractor was informed regarding the situation and reminded of the required remedial and maintenance work. It was reported with photo records by the landscape contractor that firming up for the seedlings was conducted in November 2011. A remedial action proposal including replacement planting in April 2012 was submitted to the Project Proponent.

5.3.3 Monitoring frequency was resumed to quarterly and was conducted in 2 February 2012 to check the growing conditions of the plants. Photo records of the planting and monitoring were shown in **Figure 5.4**.

5.3.4 Similar to the observation made in November 2011, individuals of the six planted species were in fair to poor conditions. *Schefflera heptaphylla,* and *Schima superba* was in fair conditions, where healthy leaves and little signs of insect attack or desiccation were observed. Other species, including *Castanopsis fissa, Machilus* sp., *Sterculia lanceolata*, and *Litsea glutinosa* suffered from various degree of herbivory and desiccation. Dead seedlings were also observed, although a few resprouted, which are signs of regeneration. Monitoring will continue to audit the replacement planting to be conducted in April 2012 and check the growing conditions of the plants.

6. ENVIRONMENTAL AUDITING

6.1 Site Inspections

6.1.1 The site inspections were conducted on 7,14,21,28 February 2012. The monthly Site Safety and Environmental Management Committee (SSEMC) site meeting and inspection audit with the Contractor, Project Proponent, Project Architect and IEC was carried out on 14 February 2012. A detailed checklist of each site inspection together with comments, relevant photos and maps have been filed and kept. The findings and results of site inspections are summarized in **Appendix I**.

Water Quality

6.1.2 During this reporting period, the waste water treatment facility for canteen section was not in operation and the direct discharge of muddy water was observed on 28 February 2012. It was because rainy weather conditions caused the surface runoff and not enough protection measures were implemented. The exposed area was not covered with tarpaulin sheets. In addition, the capacity of the sedimentation tank was not enough and caused overflows. The capacity of the sump pit for collection of surface run off was not enough and the pumps not in stand-by mode. For the dorm section, the exposed area was not covered with tarpaulin sheets and muddy water accumulated at the sump pit and the muddy water also accumulated at the toe wall during the rainy weather. Automated mode was not turned on for both the pumps and the water treatment system. The waste water treatment systems for both canteen section and dorm section were not implemented properly. Remdeial actions were taken to rectify the water treatment systems (see Section 6.2.1).

6.1.3 Stagnant water was always observed of the canteen section on 7, 14, 21 and 28 February 2012. Contractor was reminded of preventing acculumation of surface runoff at the site. Monitoring will continue until it is rectified.

Waste Management

6.1.4 Accumulation of green wastes was observed on 7, 14 and 21 February 2012. The green wastes were cleaned by contractor on 28 February 2012.

6.1.5 It is the contractor's responsibility to ensure that all wastes produced during the construction phase for the Project are handled, stored and disposed of in accordance with good waste management practices and EPD's regulation and requirement. Waste materials generated during construction activities, such as construction and demolition (C&D) material and general refuse were inspected during weekly site audit by ET to ensure that proper storage, transportation and disposal practices are being implemented.

6.1.6 The waste generation and disposal in reporting month is summarized in Table 6.1. The contractor was reminded to dispose the observed green waste generated and accumulated on site on a timely manner.

Table 6.1 Summary of Waste Disposal in the Reporting Month

Type of Waste	Disposal Site	Disposed Quantity	Remark
Inert C&D waste	TKO Area 137	16.3 tonnes	Mixed rock and soil

Type of Waste	Disposal Site	Disposed Quantity	Remark
	Landfill		
Non-inert C&D Waste	SENT Landfill, NENT Landfill	26.47 tonnes	Including general refuse, fell trees

Landscape and Visual Environment

6.1.7 Generally, the Contractor had provided proper landscape and visual mitigation measures during inspection. Contractor was reminded to complete the construction of proper fencing as tree protection zone at the dormitory site and repair broken tree protection fencing at both the canteen and dormitory sites.

6.2 Non-Compliance Event

6.2.1 The direct discharge of muddy water observed on 28 February 2012, as described in 6.1.2 constituted a non-compliance event. The ET notified the contractor immediately during the site inspection, and the runoff was stopped. The Project Architect issued an Architectural Instruction to suspend the construction work on the next day. IEC and ET arranged a special site inspection with the contractor and architect's representative on the 1 March 2012, and several remedial actions were proposed, including:

- Canteen Section:
  - construction of the additional sump pit
  - additional water tank for storage and de-silting of runoff for pretreatment
  - turn on the water treatment system in automated mode
- Dormitory Section:
  - covering of non-working exposed area with tarpaulin sheet, and placement of sandbags on top to prevent seepage of runoff from underneath
  - construction of localised sump pit / trenching near toe wall to divert runoff to the water treatment system more effectively
  - turn on the water treatment system in automated mode

6.2.2 The remedial actions were taken, and site works resumed. Contractor was reminded to continue to implement the measures properly. Weekly monitoring will continue with special attention to implementation of the water quality control measures.

7. SUMMARY OF ENVIRONMENTAL PERMIT AND LICENSES

7.1.1 ET has checked with the Project Proponent for the status of all environmental permits and licenses for this project as of February 2012, which is summarized in **Table 7.1** below. ET will keep track of the application process of the outstanding permits/licenses to be applied by the Contractor(s) for the Project.

Table 7.1 Summary of Status of Environmental Permits/Licenses

Description	License/Permit/ Acc. No. #/Letter Ref. No.	License/ Permit Holder*	Date of Issue	Date of Expiry	Status/ Remarks
Environmental Permit	Permit No. EP-410/2010	HKFYG	10 Jan 2011	-	Issued
AFCD Letter for Works Partly Within Sai Kung Country Park	(3) AF GR CPDA SKW/33/2005	HKFYG	7 Feb 2011	Jan 2013	Issued
Tree Removal Applications	(18) in LM(3) to DLO/SK SX 1557(Pt. 5)	HKFYG	3 May 2011	-	Approved
Billing Account for Disposal of Construction Waste	7013108	KCE	30 Jun 2011	-	Issued
Registration of Chemical Waste Producer	WPN No. 5113-811-K2905-05	KCE	7 Jul 2011	-	Completed
WPCO Effluent Discharge License	WT00009985-2011	KCE	26 Oct 2011	31 Oct 2016	Issued
Further Environmental Permit	FEP-01/410/2010	KCE	5 Jan 2012	-	Issued

*HKFYG = The Hong Kong Federation of Youth Groups;
KCE = Konwall Construction and Engineering Co. Ltd.

8. CUMULATIVE LOG OF COMPLAINTS AND REMEDIAL ACTION

8.1.1 There was no complaint received in association with installation activities in the month. The cumulative log of complaints is referred in **Appendix J**.

9. CUMULATIVE LOG OF NOTIFICATION OF SUMMONS AND PROSECUTIONS

9.1.1 No notification of summons or prosecutions were received or made against the Project in the month. The cumulative log of summons and prosecutions is referred in **Appendix J**.

10. FUTURE KEY ISSUES

10.1 Key Issues for Coming Month

10.1.1 Key issues to be considered in the coming month include:

- generation of C&D material,
- mosquito control measures,
- and wastewater from drilling.

10.2 EM&A Schedule for the Coming Month

10.2.1 The tentative schedule for environmental monitoring and audit for the next month is provided in **Appendix K**.

11. CONCLUSIONS AND RECOMMENDATIONS

11.1.1 Tree protection measures and preparation works for tree transplantation are being implemented. The temporary drainage and hoarding were also under construction. The contractor was advised to construct proper temporary drainage, hoarding and fencing retained trees as soon as possible before major site works.

11.1.2 Monitoring results of compensatory mangrove planting show that survival and growth of mangrove seedlings was low. Since no mangrove loss caused by the Project is anticipated due to deletion of Platform Deck B in the revised Master Layout Plan, replanting of mangrove is not considered necessary. Mangrove planting however will be carried out as part of the nature conservation education programme as before.

11.1.3 Monitoring results of off-site woodland compensatory planting at Lui Ta Shek ranged from fair to poor. According to the Event and Action Plan for Ecological Impact, actions due to non-compliance were taken in accordance with the action plan. IEC has been informed. A remedial action proposal including replacement planting in April 2012 was submitted to the Project Proponent. Monitoring will continue to monitor remedial actions until rectification has been completed.

11.1.4 Generally, air, water quality and noise level during the reporting period were satisfactory, except one non-compliance event recorded during the last monitoring session of the month. Follow-up actions and remedial measures were taken. ET had reminded the contractor to provide environmental pollution control measures wherever necessary; and to keep a good environmental management at site practice.

11.1.5 There were no notifications of summons recorded during the reporting period. Furthermore, there were not any formal prosecution and complaints recorded.

11.1.6 The ET will continue to implement the environmental monitoring & audit programme in accordance with the EM&A Manual and Environmental Permit requirement.

FIGURES


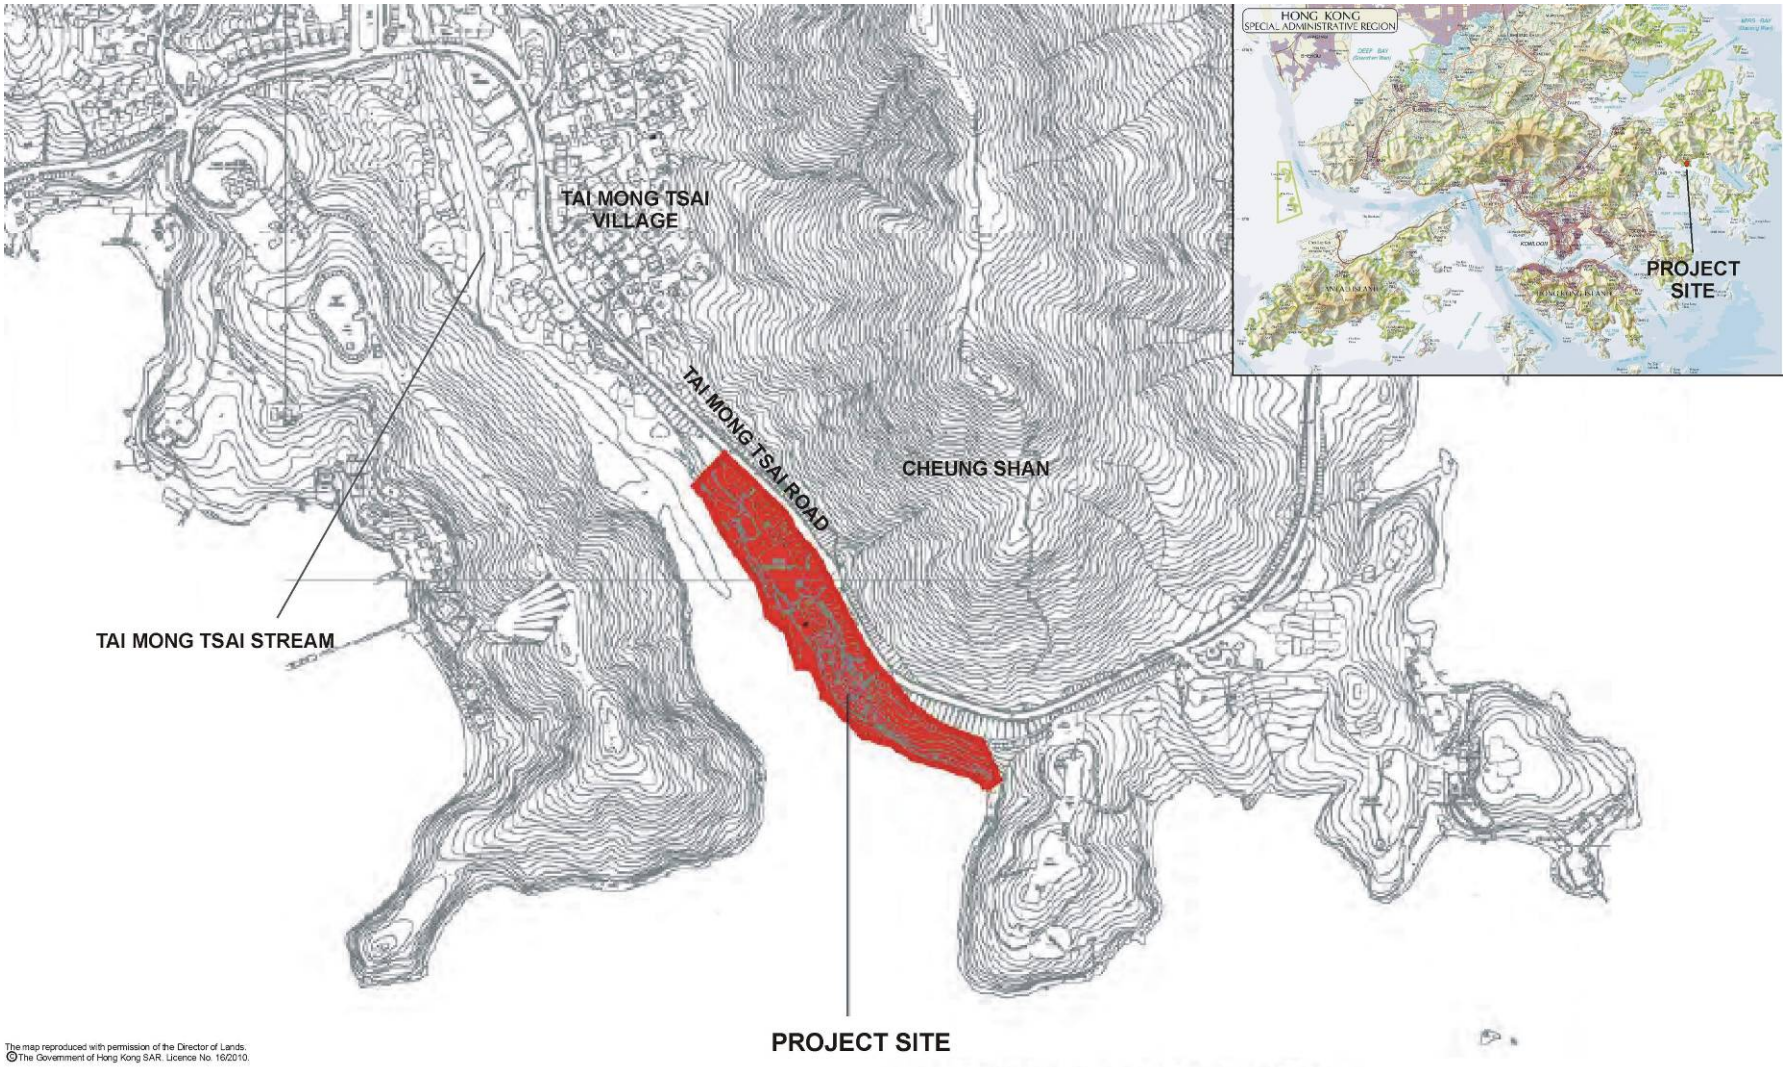


Figure 1.1 Site Location Plan

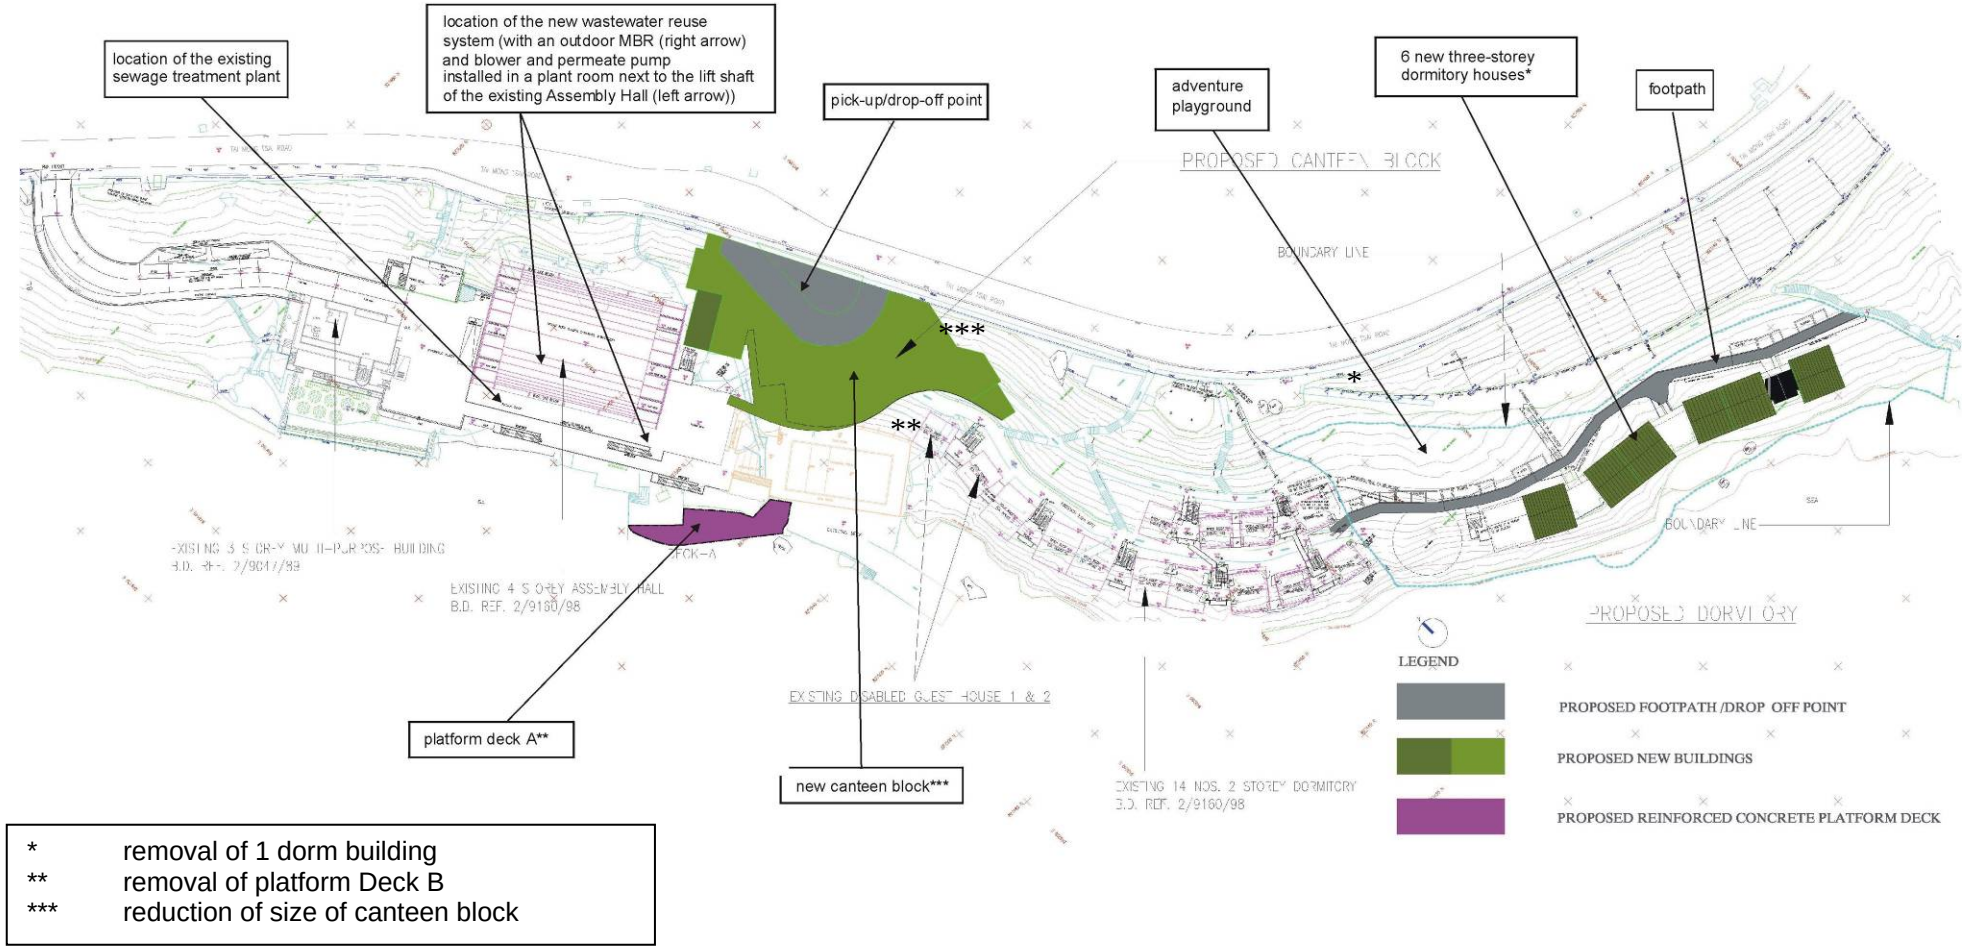

*	removal of 1 dorm building
**	removal of platform Deck B
***	reduction of size of canteen block

Figure 1.2 Master Layout Plan

TR639









1. The second root pruning was completed
2. Applied root activator after tree pruning works
3. Backfill the soil
4. Install guy and fixing on tree

TR643









1. The second root pruning was completed
2. Applied root activator after tree pruning works
3. Backfill the soil
4. Installed guy and fixing on tree

TR644









1. The first root pruning was completed
2. Applied root activator after tree pruning works
3. Backfill the soil
4. Install guy and fixing on tree

TR766








1. The first root pruning was completed
2. Applied root activator after tree pruning works
3. Backfill the soil
4. Install guy and fixing on tree

TR775



1. The first root pruning was completed
2. Applied root activator after tree pruning works
3. Backfill the soil
4. Install guy and fixing on tree

Figure 4.1 Photo Records of Second Pruning for the Incense Trees to be Transplanted

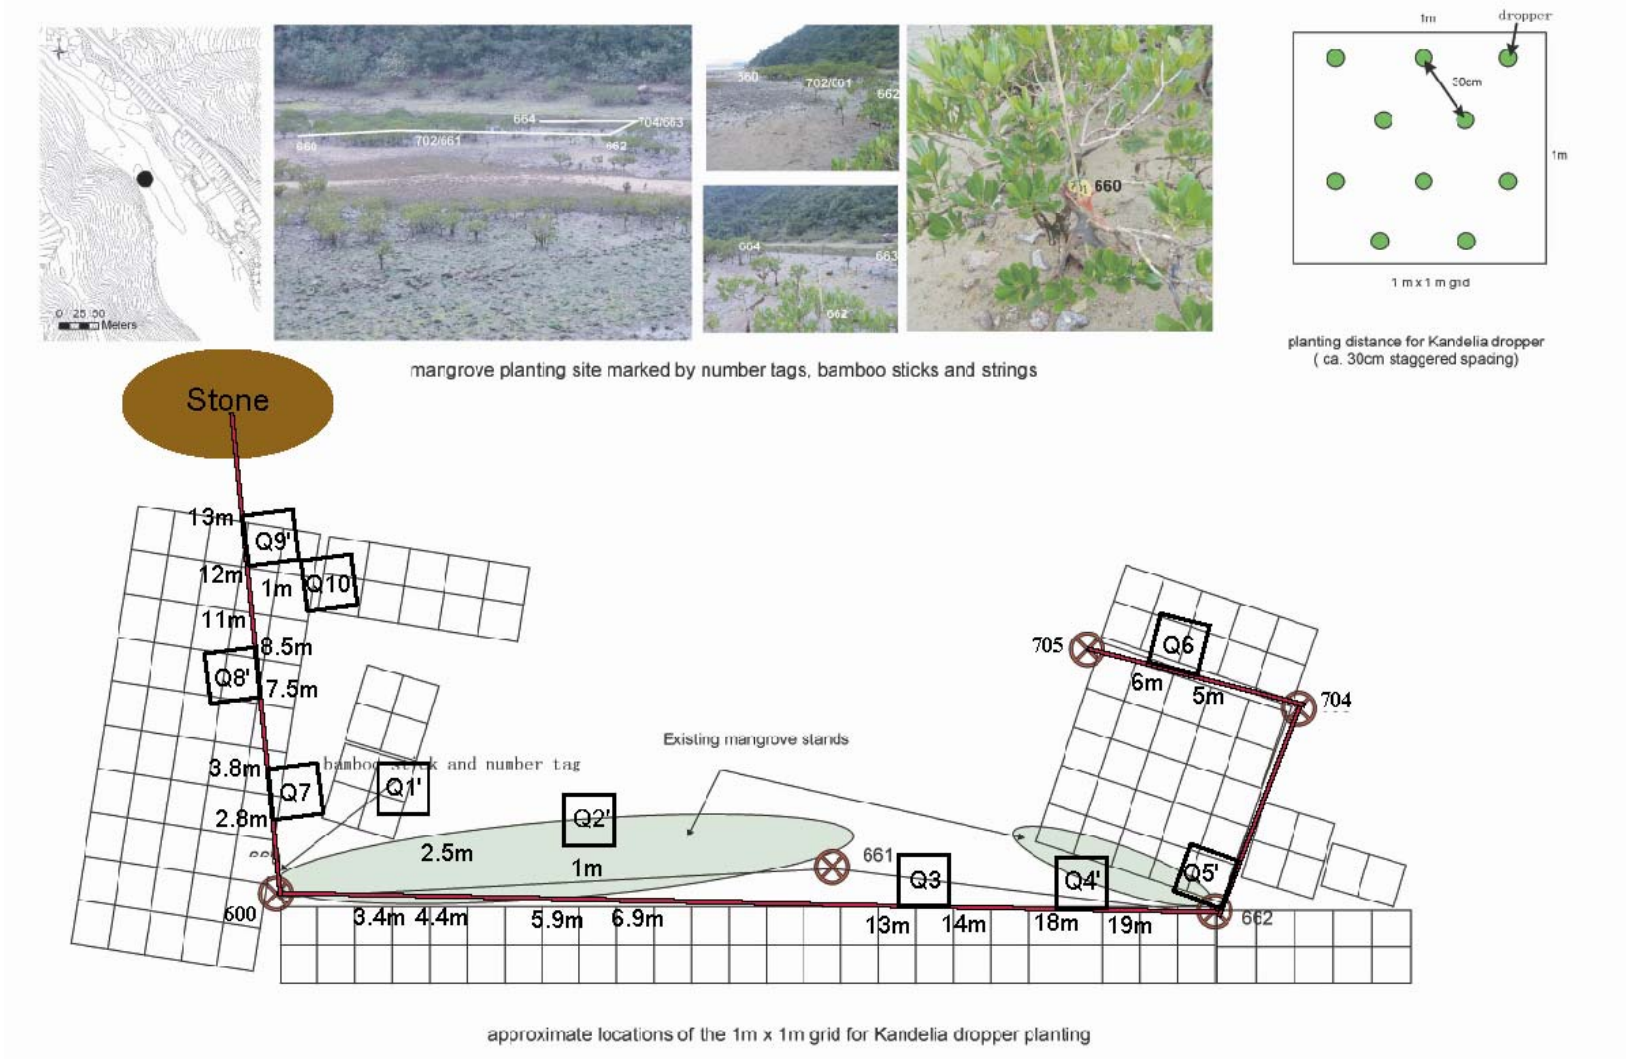


Figure 5.1 Mangrove Compensatory Planting Site and Sampling Locations

 overview of the planting area	 laying of transect	 sampling within quadrat
 growth of seedling near mature stand	 resprouted new leaves	 seedling covered by algae

Figure 5.2 Photo Records of Mangrove Seedlings

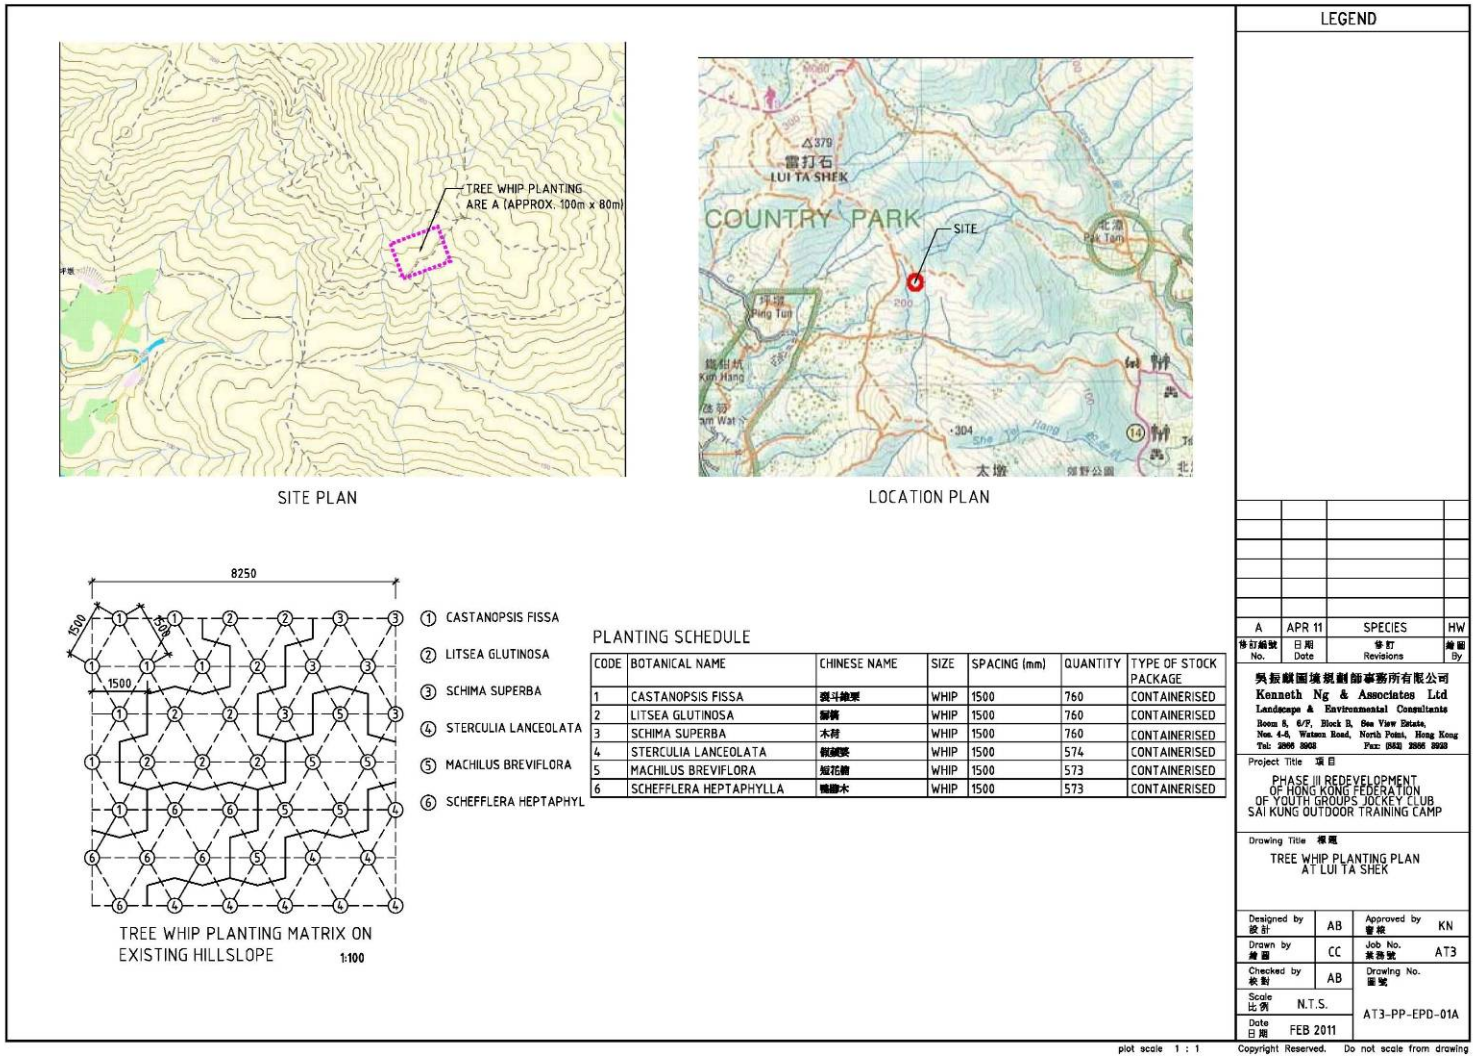



Figure 5.3 Tree Whip Planting Plan for Off-Site Woodland Compensatory Planting at Lui Ta Shek


 Schefflera heptaphylla	 Schima superba	 Castanopsis fissa
 Sterculia lanceolata	 Dead seedling	 Resprout from base of seedling

Figure 5.4 Photo Records of Woodland Compensatory Planting at Lui Ta Shek

Appendices

Appendix A Tentative Construction Programme

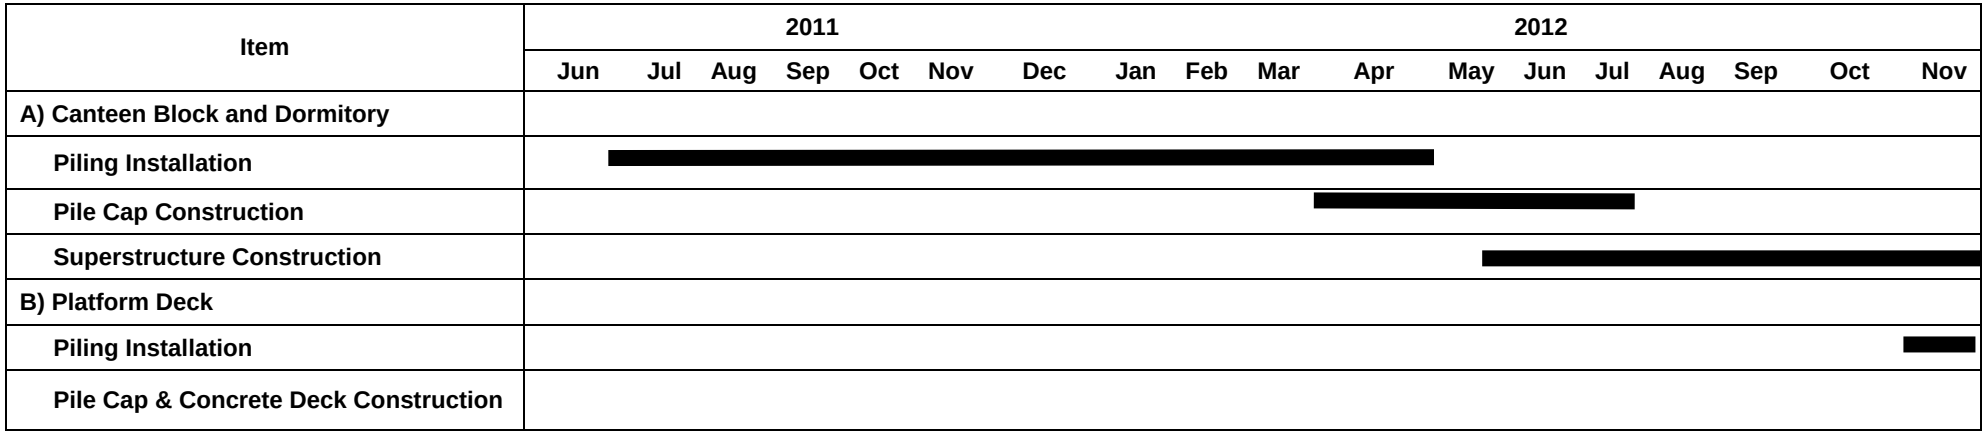


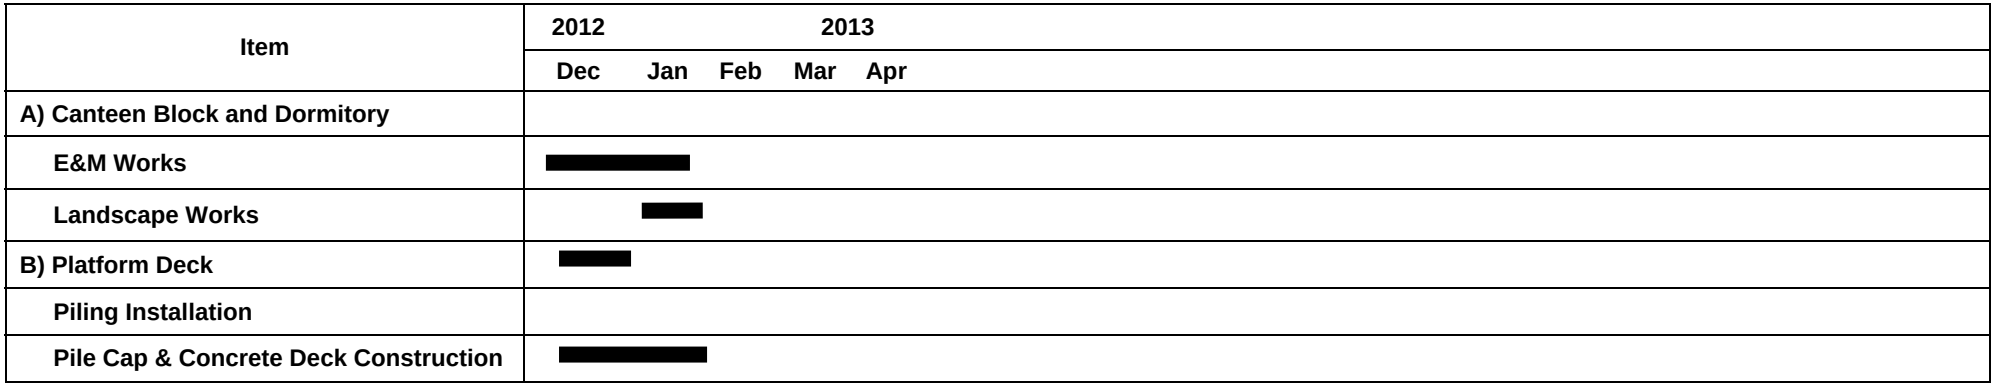

Appendix B The Key Contact Persons, Phone Numbers and Key Personnel

Party	Name	Telephone No.
Project Proponent		
The Hong Kong Federation of Youth Groups		
Deputy Executive Director	Ms. Yolanda CHIU	37557134
Engineer Representative	Mr. Greg TSE	97811411
Architect		
Atelier VIII Ltd.		
Project Architect	Mr. K.Y. KUNG	28914296
Project Architect	Ms. Stella LUK	28914296
Project Officer	Mr. Dennis LEUNG	28914296
Clerk of Works	Mr. Jovi Ha	28914296
Contractor (Foundation)		
Konwall Construction and Engineering Co. Ltd.		
Project Director	Mr. Eric KWOK	25631233
Project Manager	Mr. W. K. SETO	62020195
Site Agent	Mr. H.Y. Cheung	96348220
Environmental Officer	Mr. Joe LAM	63306705
Independent Environmental Checker		
Allied Environmental Consultants Ltd.		
IEC Team Leader	Ms. Grace KWOK	28157028
IEC Team	Mr. Ronan CHAN	28157028
Environmental Team		
Ecosystems Ltd.		
ET Leader	Mr. Vincent LAI	25530468
Deputy/Monitoring Team Leader	Ms. M. L. YAU	25530468
Environmental Pioneers and Solutions Ltd.		
Environmental Technician	Ms. Natalie Lai	25587699
Environmental Technician	Mr. Allen Chan	25587699

Appendix C Project Organisation

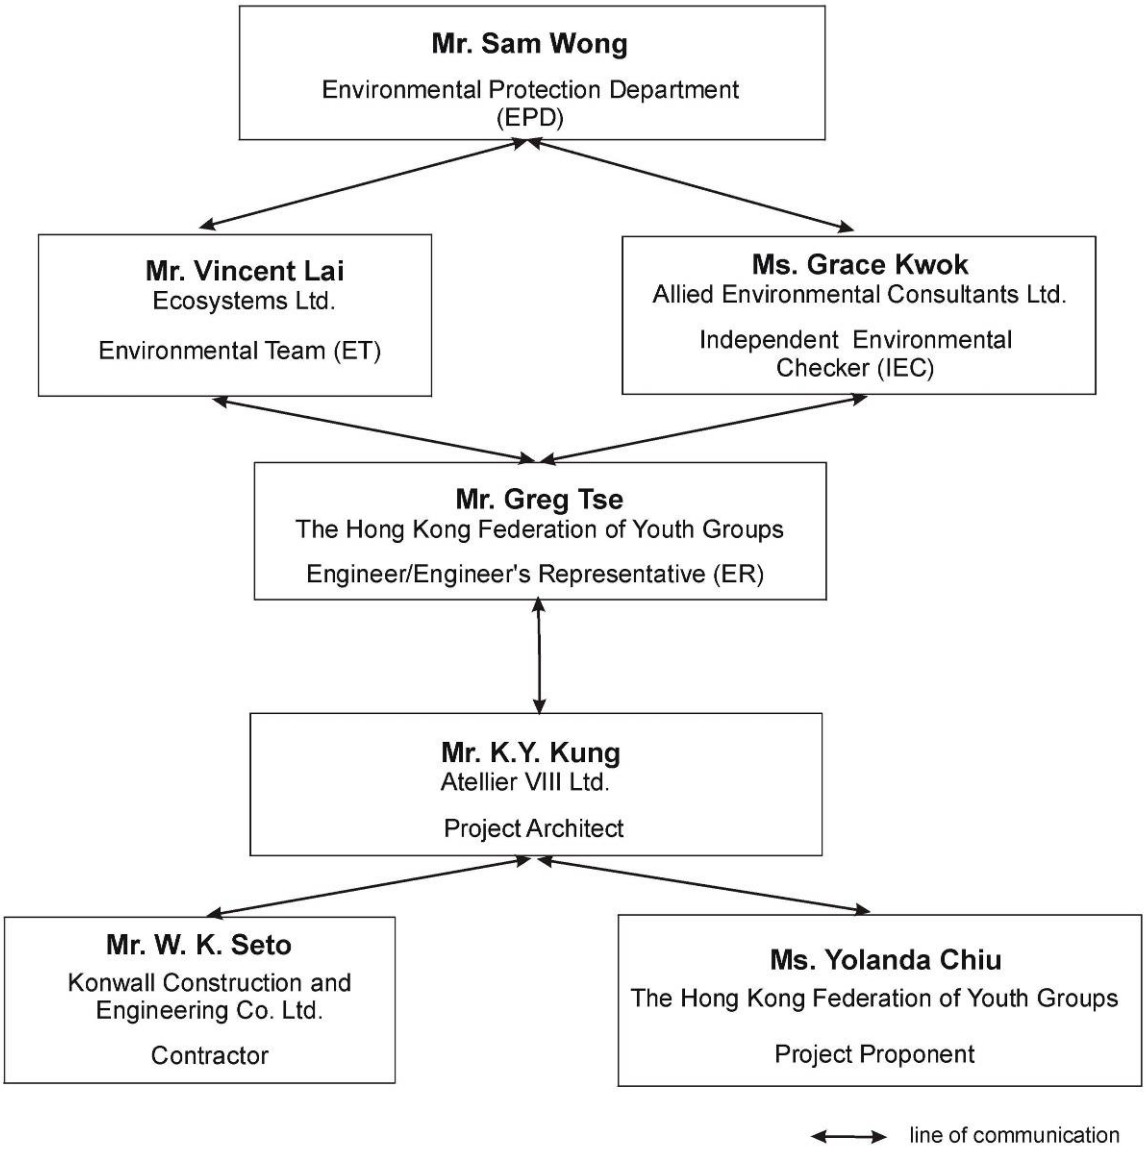

Appendix D
Event and Action Plan for Landscape and Visual Impact – Construction Phase

Action Level	Environmental Team (ET) Leader	Independent Environmental Checker (IEC)	Engineer's Representative (ER)	Contractor
Non-conformity on one occasion	1. Identify source 2. Inform the IEC and the ER 3. Discuss remedial actions with the IEC, the ER and the Contractor 4. Monitor remedial actions until rectification has been completed	1. Check report 2. Check the Contractor's working method 3. Discuss with the ER and the Contractor on possible remedial measures 4. Advise the ER on effectiveness of proposed remedial measures	1. Notify the Contractor 2. Ensure remedial measures are properly implemented	1. Amend working methods 2. Rectify damage and undertake remedial measures or any necessary replacement
Repeated Non-conformity	1. Identify source 2. Inform the IEC, the ER and EPD 3. Increase monitoring (site audit) frequency 4. Discuss remedial actions with the IEC, the ER and the Contractor 5. Monitor remedial actions until rectification has been completed 6. If exceedance stops, cease additional monitoring (site audit)	1. Check report 2. Check the Contractor's working method 3. Discuss with the ER and the Contractor on possible remedial measures 4. Advise the ER on effectiveness of proposed remedial measures 5. Supervise implementation of remedial measures	1. Notify the Contractor 2. Ensure remedial measures are properly implemented	1. Amend working methods 2. Rectify damage and undertake remedial measures or any necessary replacement

Appendix E
Event and Action Plan for Ecological Impact – Construction Phase

Action Level	Environmental Team (ET) Leader	Independent Environmental Checker (IEC)	Camp operator/ Landscape Contractor
Poor survival or health of mangrove planting	1. Identify source 2. Inform the IEC 3. Discuss remedial actions with the IEC and Camp operator 4. Monitor remedial actions until rectification has been completed	1. Check report 2. Discuss with the Camp operator on possible remedial measures 4. Advise the Camp operator on effectiveness of proposed remedial measures	1. Amend planting programme and replant as necessary
Poor survival or health of woodland planting	1. Identify source 2. Inform the IEC 3. Discuss remedial actions with the IEC and Landscape Contractor 4. Monitor remedial actions until rectification has been completed	1. Check report 2. Discuss with the Landscape Contractor on possible remedial measures 4. Advise the Landscape Contractor on effectiveness of proposed remedial measures	1. Amend maintenance programme and replant as necessary
Poor survival of transplanted trees	1. Identify source 2. Inform the IEC 3. Discuss remedial actions with the IEC and Landscape Contractor 4. Monitor remedial actions until rectification has been completed	1. Check report 2. Discuss with the Landscape Contractor on possible remedial measures 4. Advise the Landscape Contractor on effectiveness of proposed remedial measures	1. Amend maintenance programme and replant as necessary

Appendix F Implementation Schedules for Mitigation Measures

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
Noise								
3.6.1	2.3.1	• Contractor shall comply with and observe the Noise Control Ordinance (NCO) and its current subsidiary regulations; • Before the commencement of any work, the Contractor shall submit to the Engineer for approval the method of working, equipment and sound-reducing measures intended to be used at the Project Site; • Contractor shall devise and execute working methods that will minimise the noise impact on the surrounding environment, and shall provide experienced personnel with suitable training to ensure that these methods are implemented; • Only well-maintained plant and equipment should be operated on-site; • Plant/equipment should be serviced regularly during the construction programme; • Machines that may be in intermittent use should be shut down or throttled down to a minimum between work periods; • Silencers and/or mufflers on construction equipment should be utilised and should be properly maintained during the construction programme; • Noisy activities should be scheduled to minimise exposure of nearby NSRs to	Y Y Y Y Y Y Y Y	Good site practices to minimise construction Noise Impact	The Contractor	Construction Site	Construction Phase	EIAO and Environmental Permit; NCO and its regulations

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		high levels of construction noise. For example, noisy activities should be scheduled for midday or at times coinciding with periods of high background noise (such as during peak traffic hours); • Noisy equipment such as emergency generators shall always be sited as far away as possible from noise sensitive receivers; • Mobile plant/equipment should be sited as far away from NSRs as possible; and • Material stockpiles and other structures should be effectively utilised as noise barriers, where practicable.	Y Y N/A					
Water								
4.7.2	3.3.1	• High loading of suspended solids (SS) in construction site runoff shall be prevented through proper site management by the contractor; • The boundary of critical work areas shall be surrounded by sandbags, ditches, or embankments. Accidental release of soil or refuse onto the adjoining land should be prevented by the provision of site hoarding or earth bunds at the site boundary. These facilities should be constructed in advance of site formation works and roadworks; • Consideration should be given to plan construction activities to allow the use of natural topography of the Project Site as a barrier to minimise uncontrolled non-point source discharge of construction	On-going On-going Y	Good site practices to minimise construction water quality Impact due to potential site runoff and chemical leakage	The Contractor	Construction Site	Construction Phase	EIAO and Environmental Permit; WPCO and its regulations

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		site runoff; • Temporary ditches or earthen bunds should be provided to facilitate directed and controlled discharge of runoff into storm drains via sand/ silt removal facilities such as sand traps, silt traps and sediment retention basin. Oil and grease removal facilities should also be provided where appropriate, for example, in area near plant workshop/ maintenance areas; • Sand and silt removal facilities, channels and manholes should be maintained and the deposited silt and grit should be removed regularly by the contractor, and at the onset of and after each rainstorm to ensure that these facilities area functioning properly; • Slope exposure should be minimised where practicable especially during the wet season. Exposed soil surfaces should be protected from rainfall through covering temporarily exposed slope surfaces or stockpiles with tarpaulin or the like; • Haul roads should be hard paved by laying crushed rock, gravel or other granular materials to minimise discharge of contaminated runoff; • Plant workshop/ maintenance areas, if any, should be bunded and constructed on a hard standing. Sediment traps and oil interceptors should be provided at appropriate locations; • Manholes (including newly constructed ones), if any, should be adequately	In progress In progress Y Y Y N					

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		covered or temporarily sealed so as to prevent silt, construction materials or debris from getting into the drainage system; • Construction works should be programmed to minimise soil excavation works where practicable during rainy conditions; • Chemical stores should be contained (bunded) to prevent any spills from contact with water bodies. All fuel tanks and/ or storage areas should provided with locks and be sited on hard surface; • Chemical waste arising from the construction of the Project Site should be properly stored, handled, treated and disposed of in compliance with the requirements stipulated under the Waste Disposal (Chemical Waste) (General) Regulation; • Drainage facilities must be adequate for the controlled release of storm flows.	Y Y Y Y					
4.7.2	3.3.1	• Sewage generated from the construction workforce should be contained in chemical toilets until connection to public foul sewer can be provided. Chemical toilets should be provided at a minimum rate of about 1 per 50 workers. The facility should be serviced and cleaned by a specialist contractor at regular intervals; • Vehicle wheel washing facilities should be provided at the site exit such that mud, debris, etc. deposited onto the vehicle wheels or body can be washed off before the vehicles leave the Project	Y In Progress	Good site practices to control the wastewater generated from the construction site	The Contractor	Construction Site	Construction Phase	

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		site; • The section of the road between the wheel washing bay and the public road should be hard paved with backfill to reduce vehicle tracking of soil and to prevent site run-off from entering public road drains.	Y					
4.7.3	3.3.1	• Spillage of fuel oils or other polluting fluids should be prevented at source. It is recommended that all stocks should be stored inside proper containers and sited on sealed areas, preferably surrounded by bunds	Y	Good site practices to minimise construction water quality Impact due to avoid spillage of chemical				
4.7.6	3.3.2	• Apart from the online monitoring and control system for the wastewater quality, regular sampling programme will be devised to further safeguard and ensure that the quality of the treated effluent is suitable for reuse. Should the treated effluent not meet the required standards for irrigation and flushing or in case of breakdown of the wastewater system, a contingency plan would be triggered. The wastewater reuse system will be shut down. The canteen wastewater from Phase III will be held in the new holding tank for the MBR. The new holding tank has a capacity of 15m^3 and a minimum storage time of half day capacity. The canteen wastewater will then be diverted to the existing sewage treatment plant via the coarse screen chamber, and it will be held in the equalisation holding tank, with a	N/A	Contingency plan to further safeguard the water quality of the surrounding environment and ensure that the quality of the treated effluent is suitable for reuse	Proponent	Project Area	During design, construction and operation	EIAO and Environmental Permit; WPCO and its regulations

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		capacity of 96m^3, for screening and treatment. The existing sewage treatment plant (with maximum treatment capacity of 152.7m^3/d) for Phase I & II has a daily flow of 35m^3 per day, so it has a spare capacity of more than 50%, which is adequate to treat the canteen wastewater. The treated effluent for direct discharge will not undergo any chlorination process. During this period, both irrigation system and flushing system will use the fresh water from city main as water source. The water reuse system would be fully inspected for problem fixing before re-operation.						
Air Quality								
5.7.2	4.3.1	• The designated haul road should be hard paved; • The site should be water sprayed four times a day during site formation work of the residential portion of the Project Site; • Dump truck beds for material transport should be totally enclosed using impervious sheeting; • any excavated dusty materials or stockpile of dusty materials should be covered entirely by impervious sheeting or sprayed with water so as to maintain the entire surface wet, and recovered or backfilled or reinstated within 24 hours of the excavation or unloading; • The stockpiled malodorous materials, if	Y Y Y Y N/A	Good site practice to minimise construction fugitive dust impact	The Contractor	Construction Site	Construction Phase	EIAO and Environmental Permit; APCO and its regulations

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		any, should be placed as far as possible from any ASRs and removed from Project Site as soon as possible, and they should be covered entirely by plastic tarpaulin sheets;						
		• Dusty materials remaining after a stockpile is removed should be wetted with water;	Y					
		• The vehicle washing area and the section of the road between the washing facilities and the exit point should be paved with e.g. concrete, bituminous materials or hardcore or similar;	Y					
		• Stockpile of dusty materials to be either covered entirely by impervious sheeting, placed in an area sheltered on the top and the 3 sides; or sprayed with water so as to maintain the entire surface wet;	Y					
		• All dusty materials to be sprayed with water prior to any loading, unloading or transfer operation so as to maintain the dusty material wet;	Y					
		• Vehicle speed to be limited to 10 kph except on completed access roads;	Y					
		• The portion of road leading only to a construction site that is within 30 m of a designated vehicle entrance or exit should be kept clear of dusty materials;	Y					
		• Every vehicle should be washed to remove any dusty materials from its body and wheels before leaving the construction sites;	N					
		• The load of dusty materials carried by vehicles leaving a construction site should be covered entirely by clean impervious sheeting to ensure that the	Y					

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		dusty materials do not leak from the vehicle; • The working area of excavation should be sprayed with water immediately before, during and immediately after (as necessary) the operations so as to maintain the entire surface wet.	Y					
Ecology								
6.9.3	5.2.2	Preserve three no. and transplant five no. of *Aquilaria sinensis*	In progress	Minimise construction ecological impacts on species on protected species	Contractor	On Project Site	Construction Phase	ETWB(W) 3/2006: Tree Preservation. Agree on the maintenance requirement and programme
6.9.7	5.2.3	Compensatory mangrove planting (0.01 ha)	Y	Mitigate loss of 0.01 ha of mangrove	Proponent	Sandflat near Project Site	Construction Phase	Agree on the maintenance requirement and programme
6.9.8	5.2.4	Compensatory woodland planting (0.03 ha within Project Site and 0.8 ha in Sai Kung West Country Park)	N (within Project Site) Y (in Sai Kung West Country Park)	Mitigate loss of 0.31 ha of woodland	Contractor	On Project Site and Lui Ta Shek inside Sai Kung West Country Park	Construction Phase	Agree on the maintenance requirement and programme
6.9.4	5.2.6	Good site practices	Y	To minimise environmental impacts and therefore potential ecological impacts within and near the construction site	Contractor	Entire construction site	Construction Phase	N/A
Landscape and Visual								

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
Table 7.12	Table 6.2	LMM1 – Minimizing construction area and contractor's temporary works area to avoid unnecessary impacts to landscape resources and minimize visual intrusion.	Y	Preservation of landscape resources and minimize visual intrusion	Contractor	Project area	During design and construction	EIAO-TM Annex 10, 18
Table 7.12	Table 6.2	LMM2 – Sensitively designed site hoarding in both color and form to screen view to the construction works.	In progress	Visual enhancement	Contractor	Project area	During design and construction	EIAO-TM Annex 10, 18
Table 7.12	Table 6.2	LMM3 – Preservation of existing tree to be retained on area not affected by the proposed development.	Y	Conservation of existing trees; Visual screen	Contractor	Project area	During construction	EIAO-TM Annex 10, 18 LAO PN No. 7/2007
Table 7.12	Table 6.2	LMM4 – Demarcation of the tree protection zone for retain trees.	In progress	Preservation of existing trees	Contractor	Project area	During construction	EIAO-TM Annex 10, 18 Demarcation of temporary protective fencing shall be agreed and erected before other works commence
Table 7.12	Table 6.2	LMM5 – Operational time restrictions to limit after dark welding and lighting.	Y	Limit night time glare	Contractor	Project area	During construction	EIAO-TM Annex 10, 18
Table 7.12	Table 6.2	LMM6 – Selection of fast growing native trees and shrubs mix in compensation for the removal / disturbance area.	Y	Visual screen; Landscape compensation	Contractor for planting HKFYG for management and maintenance	Project area	During design, construction and operation	EIAO-TM Annex 10, 18 Selection and agree on the specified plant species
Table 7.12	Table 6.2	LMM7 – Landscape treatment such as green roof, vertical greening and screen planting including climber plants to screen and soften surface of built structures and mitigate the landscape and visual impact.	Y	Visual enhancement	Contractor during construction HKFYG for management	Project area	During design, construction and operation	EIAO-TM Annex 10, 18 Selection and agree on the specified plant

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
					and maintenance			species
Table 7.12	Table 6.2	LMM8 – Staggered built form with building height corresponding to the natural sloping landform to enhance visual quality.	Y	To provide an interesting view on the visual receiver and to lower the overwhelming effect as may be created by the proposed building blocks	Contractor during construction HKFYG for management and maintenance	Project area	During design, construction and operation	EIAO-TM Annex 10, 18
Table 7.12	Table 6.2	LMM9 – Sensitive treatment and design to external finishes of the built structure to ensure element with colour, texture and tonal quality being compatible to the existing landscape context.	Y	Visual enhancement	Contractor during construction HKFYG for management and maintenance	Project area	During design, construction and operation	EIAO-TM Annex 10, 18
Table 7.12	Table 6.2	LMM10 – Maintenance of planting works upon completion.	In progress	Landscape compensation	Contractor for planting and maintenance during establishment HKFYG for management and maintenance	Project area	During operation	EIAO-TM Annex 10, 18 Agree on the maintenance requirement and programme
Waste Management								
8.4.6	7.2.5	• Storage of different waste types – different types of waste should be segregated and stored in different	Y	Waste management measures for	The Contractor	Construction Site	Construction Phase	EIAO and Environmental Permit;

EIA Ref.	EM&A Ref.	Recommended Mitigation Measures	Implementation Status of the Mitigation Measures*	Objectives of the Recommended Measure & Main Concerns to address	Who to implement the measure?	Location of the measure	When to implement the measure?	What requirements or standards for the measure to achieve
		containers, skips or stockpiles to enhance reuse or recycling of materials and their proper disposal. An on-site temporary storage area equipped with required control measures (e.g. dust) should be provided; • Trip-ticket system – in order to monitor the proper disposal of non-inert C&D waste to landfills and to control fly-tipping, a trip-ticket system should be included as one of the contractual requirements and audited by the Environmental Team; • Records of Wastes – a recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be proposed; • Training – The contractor should provide his workers with proper training of appropriate waste management procedure to achieve waste reduction as far as practicable and cost-effective through recovery, reuse and recycling and avoid contamination of reusable C&D materials; • Incorporate the "Recommended Pollution Control Clauses for Construction Contracts" in respect to removal of waste material from the construction site into the contract of the contractor.	Y Y Y Y	construction phase				Various guidelines stated in paragraph 8.2 of the EIA report

*Y = implemented, N = not yet implemented, N/A = not applicable


Appendix G Monitoring Schedule for February 2012 and Weather Conditions during the Monitoring Period

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
			1/2	2/2	3/2	4/2
				Ecological Monitoring		
5/2	6/2	7/2	8/2	9/2	10/2	11/2
		Site inspection				
12/2	13/2	14/2	15/2	16/2	17/2	18/2
		Ecological Monitoring, Site inspection and SSEMC				
19/2	20/2	21/2	22/2	23/2	24/2	25/2
		Site inspection				
26/2	27/2	28/2	29/2			
		Site inspection				

Survey Date	Weather Condition
2/2/2012	Overcast
7/2/2012	Fine
14/2/2012	Rainy
21/2/2012	Overcast
28/2/2012	Rainy

Monthly Mean Air temperature	16.2 C
Monthly Total Rainfall	23.7 mm

Appendix H Average Height of Mangrove Seedlings

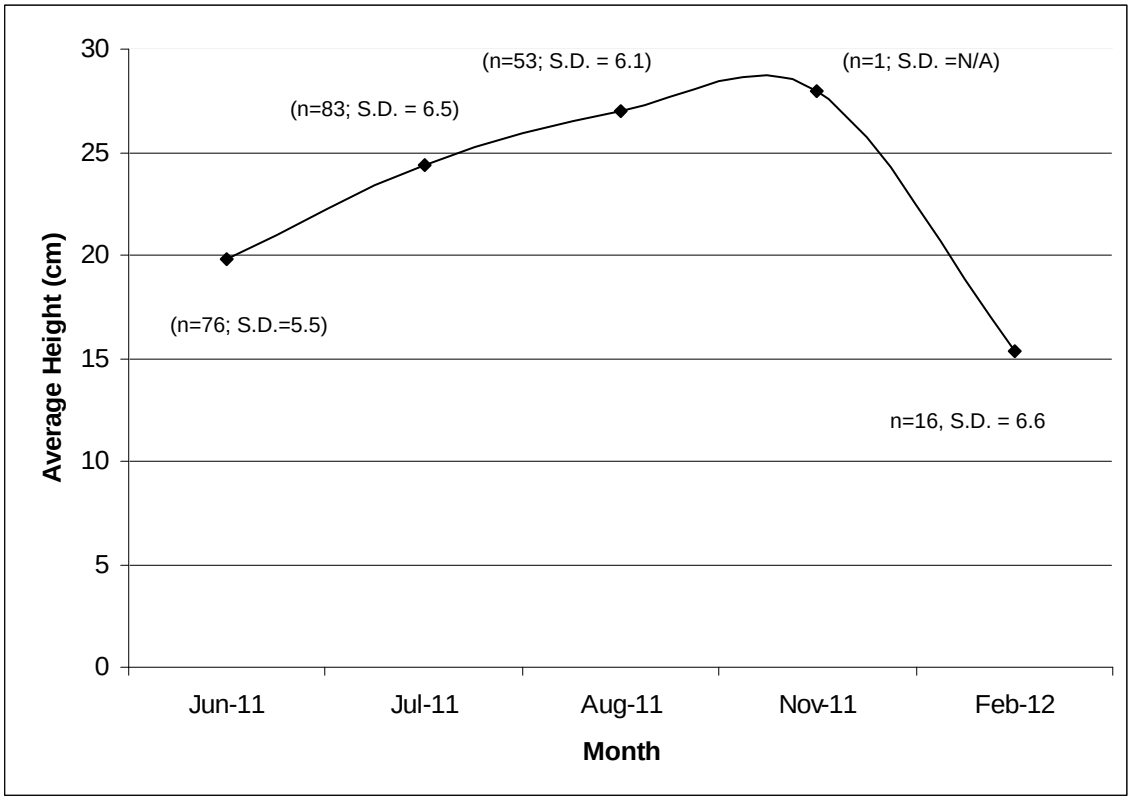

Appendix I Summary of Site Inspection, Outstanding Issues and Deficiencies

Date	Findings	Advice from ET	Action taken	Closing date
7 Jul 11 7, 14, 21 & 28 Feb 12	No hoarding for demarcation the site boundary was observed at dorm section.	Contractor was advised to provide proper fencing or protective net to demarcate a temporary site boundary and construct hoarding as soon as possible.	Partially hoarding was constructed by contractor. To be following during next reporting period.	Ongoing
20 Sep 11 & 29 Dec 11 3, 10, 17, 24 & 31 Jan 12 7, 14 & 21 Feb 12	Green waste was observed within the site area.	Contractor was reminded to remove these materials and implement good housekeeping practices. All collected green waste should be segregated and temporarily stored properly on-site and disposed of in an appropriate manner.	All green wastes were cleaned by contractor	28 Feb 12
29 Dec 11. 3, 10, 17& 31 Jan 12 7, 14 & 21 Feb 12	Green waste was observed within canteen section.	Contractor was reminded to remove these materials and implement good housekeeping practices. All collected green waste should be segregated and temporarily stored properly on-site and disposed of in an appropriate manner	All green wastes were cleaned by contractor	28 Feb 12
15, 22 & 29 Nov 11 6, 13 20 & 29 Dec 11 3,10,17,24 & 31 Jan 12 7& 14 Feb 12	No temporary drainage is constructed at the dorm site although pre-drilling has been commenced.	Contractor was reminded to provide sufficient measures to prevent runoff outside the site boundary as soon as possible before pre-drilling works continue.	Temporary drainage was constructed by contractor	21 Feb 12
3, 10, 17 & 31 Jan 12 7 Feb 12	Earthy stockpile was observed without covering.	Contractor was reminded that earthy stockpile should be covered for dust suppression after use.	Earthy stockpile was removed by contractor	14 Feb 12
31 Jan 12 7, 14, 21 & 28 Feb 12	Stagnant water was observed at canteen section	Contractor was reminded to clean the stagnant water immediately to prevent mosquito breeding	Part of stagnant water was removed by contractor on 28 Feb 12 To be following during the next reporting period	Ongoing
7 Feb 12	Construction materials were observed inside the U-channel.	Contractor was advised to remove those materials to prevent blockage of drains.	Construction materials were removed by contractor.	14 Feb 12
14, 21 Feb 12	Wheels washing facilities for canteen section was not	Contractor was reminded to provide the wheels washing facility.	To be following during next reporting period.	Ongoing

Date	Findings	Advice from ET	Action taken	Closing date
	provided			
14, 21 & 28 Feb 12	Construction materials were observed outside the hoarding at dorm section.	Contactor was reminded that the construction materials outside the hoarding should be removed.	To be following during next reporting period.	Ongoing
14, 21 & 28 Feb 12	Orange plastic meshes were observed at access road of dorm section.	Contractor was reminded to clean the orange plastic meshes as soon as possible.	To be following during next reporting period.	Ongoing
14 & 21 Feb 12	The WEBSEP tanks were not in operation both canteen section and dorm section.	Contractor was reminded to connect the water treatment system.	The WEBSEP tank for dorm section was in operation on 21 Feb 12. The WEBSEP tanks for canteen section was in operation on 28 Feb 12	28 Feb 12
28 Feb 12	Direct discharge of muddy water was observed.	Contractor was reminded that the waste water should be treated before discharge into public drain and complies with discharge license.	To be following during next reporting period.	Ongoing.
28 Feb 12	Overflow of sedimentation tank was observed at canteen section.	Contractor was reminded to prepare more sedimentation tanks at canteen section.	To be following during next reporting period.	Ongoing
28 Feb 12	Overflow of sump pit was observed at dorm section.	Contractor was reminded to extend the width and the depth of the sump pit or turn on the pump to automated mode.	To be following during next reporting period.	Ongoing
28 Feb 12	Untreated water was directly pumped to access road from the de-silting tank at the site entrance area.	Contractor was reminded that the waste water should be pumped to the waste water treatment system for further treatment.	To be Following during next reporting period.	Ongoing

Appendix J Cumulative Log of Complaints and Summons/Prosecutions

Reporting Month	No. of complaints in Reporting Month	No. of Summons/Prosecutions in Reporting Month
July 2011	0	0
August 2011	0	0
September 2011	0	0
October 2011	0	0
November 2011	0	0
December 2011	0	0
January 2012	0	0
February 2012	0	0
Overall Total	0	0

Appendix K Tentative Monitoring Schedule for March 2012

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1/3	2/3	3/3
4/3	5/3	6/3	7/3	8/3	9/3	10/3
		Site inspection				
11/3	12/3	13/3	14/3	15/3	16/3	17/3
		Site inspection				
18/3	19/3	20/3	21/3	22/3	23/3	24/3
		Site inspection and SSEMC				
25/3	26/3	27/3	28/3	29/3	30/3	31/3
		Site inspection				